

Published date	06/21/2016
Document number	SUPAIR_2016/06_002
Page number	1 / 4



SAFETY WARNING

SUBJECT : Chest strap's Safe-T buckle
inadvertently opening in flight

PRIORITY STATUS

☐ LOW

☐ MEDIUM

☒ CRITICAL

Problem description :

Inadvertent openings of the aluminum self-locking chest strap buckles were noticed in flight on a few SUPAIR harness models.



Concerned products :


SUPAIR harnesses equipped with self-locking aluminum buckles :

- ALTIRANDO 2 RS
- DELIGHT 2
- PIXAIR
- PARAMOTEUR EVO
- SKYPPER
- VIP 2

- There is the possibility for other harness models to have been equipped with faulty self-locking buckles.

Facts/ Ascertainment :


A few aluminum self-locking chest strap buckles used on selected SUPAIR harness models may have experienced inadvertent opening in flight. The buckles sudden releases only concerns the "Safe-T" strap and rarely happens. The problem comes from a manufacturing defect invisible by the naked eye and non reproducible during a test.

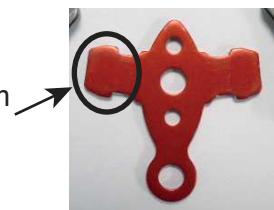

Next page ►

Procedure to follow :

How to identify if my harness is concerned ?

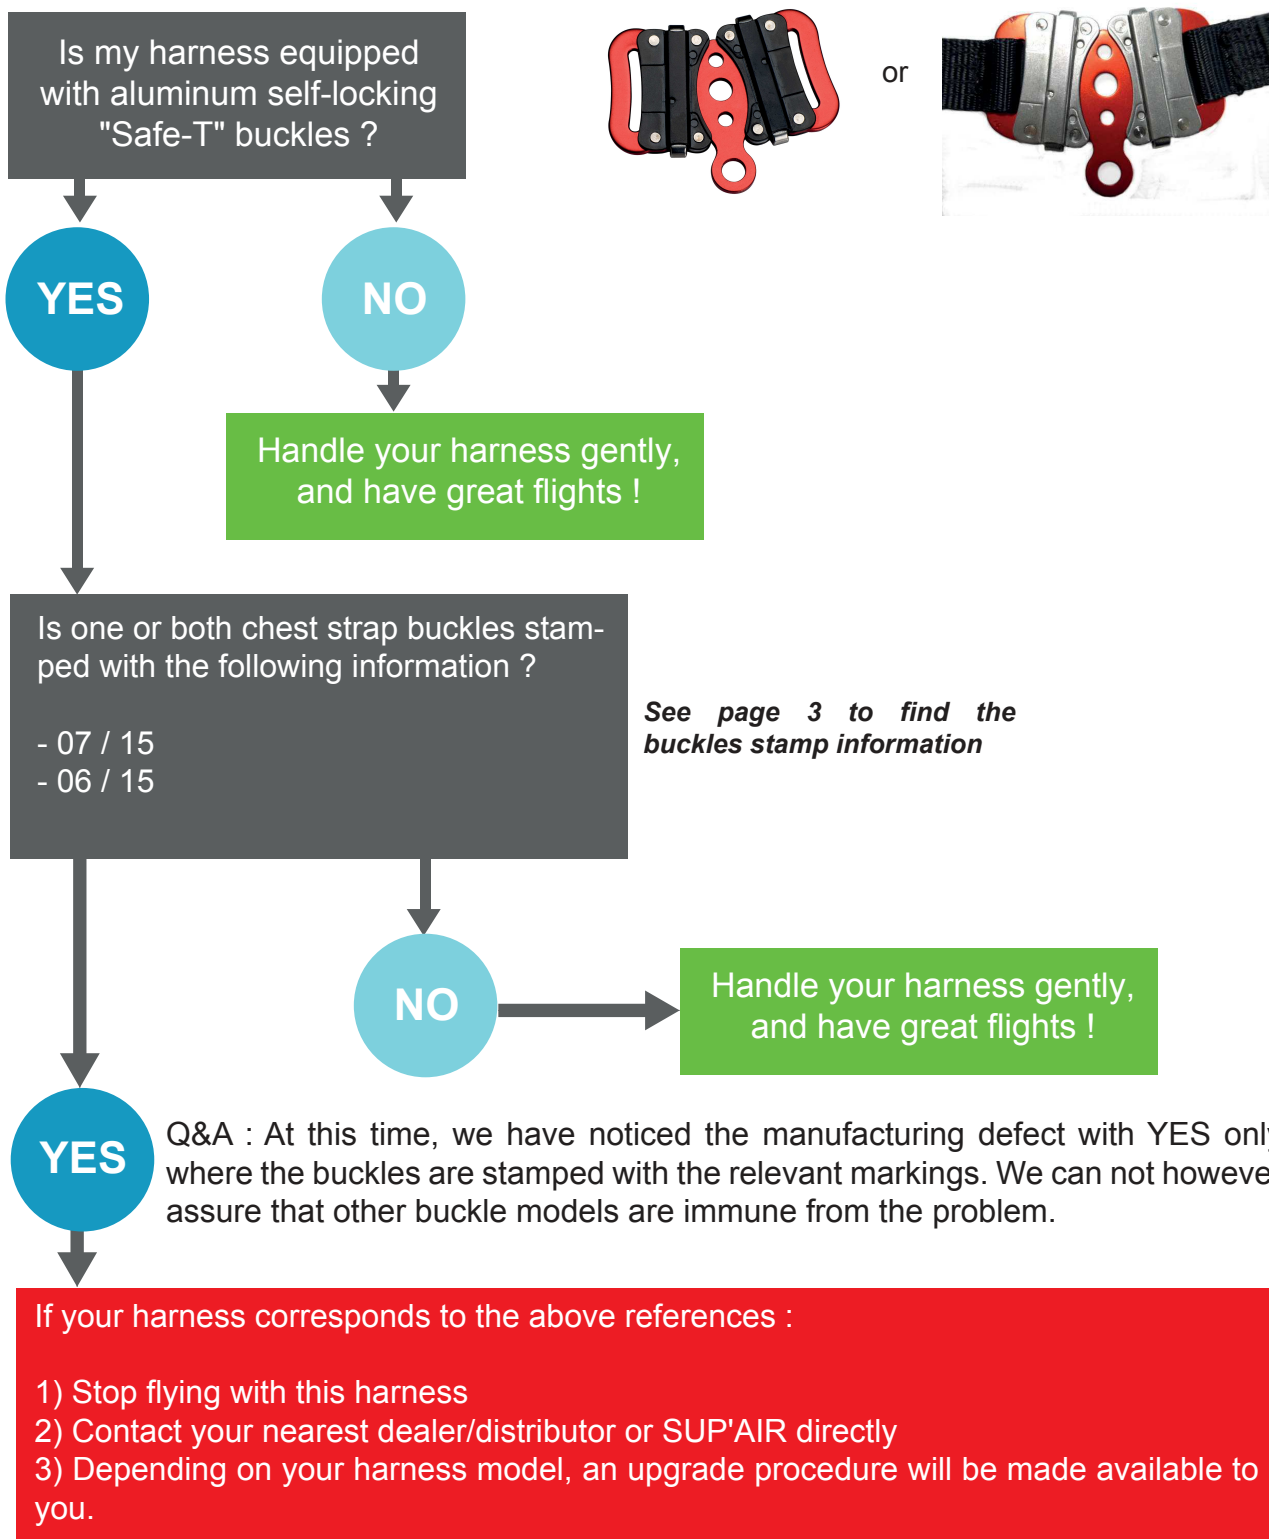

Next page ►

Where to find the self-locking buckles stamp information ?



Example :

06 / 15

RQ : If the stamped information is not visible, please contact us !

Steps to follow in case of a suspected problem :

- **Stop flying with the problem harness.**
- Fill out the form " Self-locking chest strap buckle - swapping/upgrade procedure" (see below).
- Contact your dealer or distributor who will help you with the steps to follow :

1) your harness can be repaired at home: a new "Safe-T kit" will be sent to you in order to conduct the operation yourself and safely fly afterward.

Concerned harness models: :

- **ALTIRANDO 2 RS**
- **PIXAIR**
- **PARAMOTEUR EVO**
- **SKYPPER**



See the "T" swapping instruction notice

- **DELIGHT 2**



See the "T" swapping instruction notice for DELIGHT 2

2) Your harness needs to be professionally repaired: SUPAIR will cover the repair and return shipping costs.

Concerned harness models: :

- **VIP 2**



SUPAIR repair

You also can contact SUPAIR directly at the following address: sav@supair.com
We will reply as soon as possible.

The SUPAIR Team

Next page ►

Form to fill out :

Chest strap self-locking buckle - upgrade procedure

Harness model :

Self-locking information stamping : and

Harness owner's name :

Postal address :

.....

Phone number :

E-mail address :

Person able to perform the harness :

☒ USER

☒ DEALER

☒ MANUFACTURER

Person able to conduct the repairs :

☒ USER

☒ DEALER

☒ MANUFACTURER

Except if professional repair is necessary.

DELAIS : The inspection must be done immediately

Documents recipients :

☒ USERS

☒ DEALERS

☒ SCHOOLS

☒ CLUBS

☐ MAGAZINES

☒ ASSOCIATIONS

Safety Warning : SUPAIR_2016/06_002